

## MX2N-70HB Hardware update steps

1. LAN Port, Please switch the no1 to another side as below:




2. Connecting PC and hmi/ all in one by USB downloading cable
3. Double click “Turbowriter.exe” as below:


ChangeLog.txt	2018-01-04 12:23	文本文档	6 KB
FA92_musb.bin	2018-01-04 12:23	BIN 文件	177 KB
FA92_musb_FullSpeed.bin	2018-01-04 12:23	BIN 文件	177 KB
FA93_musb.bin	2018-01-04 12:23	BIN 文件	182 KB
FA93_musb_FullSpeed.bin	2018-01-04 12:23	BIN 文件	182 KB
FA95_musb.bin	2018-01-04 12:23	BIN 文件	173 KB
FA95_musb_FullSpeed.bin	2018-01-04 12:23	BIN 文件	173 KB
musb.bin	2018-01-04 12:23	BIN 文件	46 KB
NAND ID.ini	2018-01-04 12:23	配置设置	1 KB
path.ini	2018-12-26 15:02	配置设置	1 KB
SPIFLASH ID.ini	2018-01-04 12:23	配置设置	1 KB
<b>TurboWriter.exe</b>	2018-01-04 12:23	应用程序	348 KB
TurboWriter.ini	2018-01-04 12:23	配置设置	2 KB
TurboWriterSD.ini	2018-04-25 13:44	配置设置	1 KB

4. Make the products on power to run.


5. After power on, click “Re-connect”

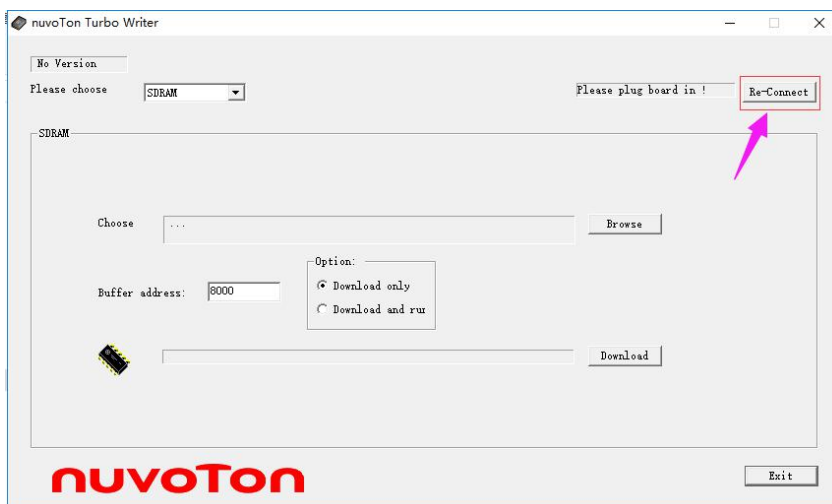


6. Please choose “NAND” as below picture

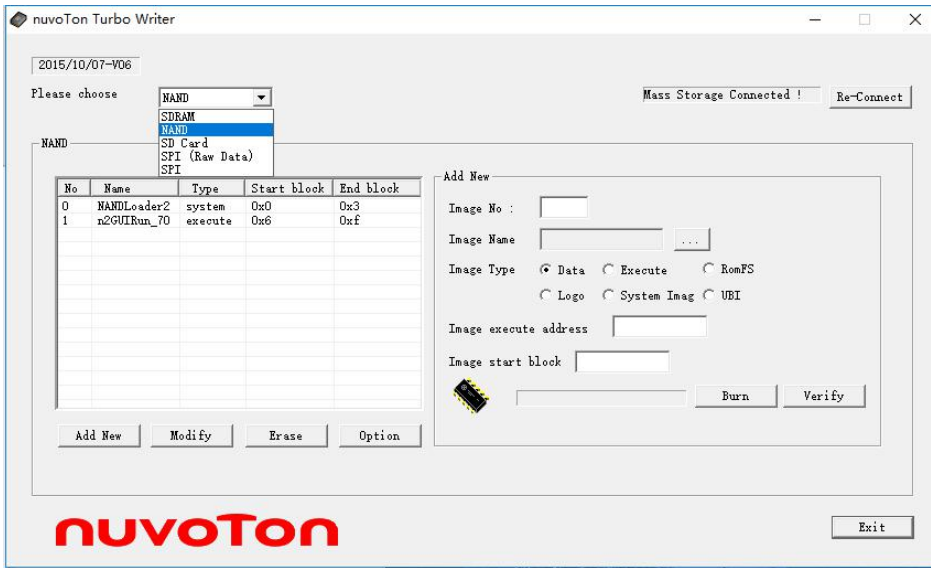


7. Select System Imag, and then run it .

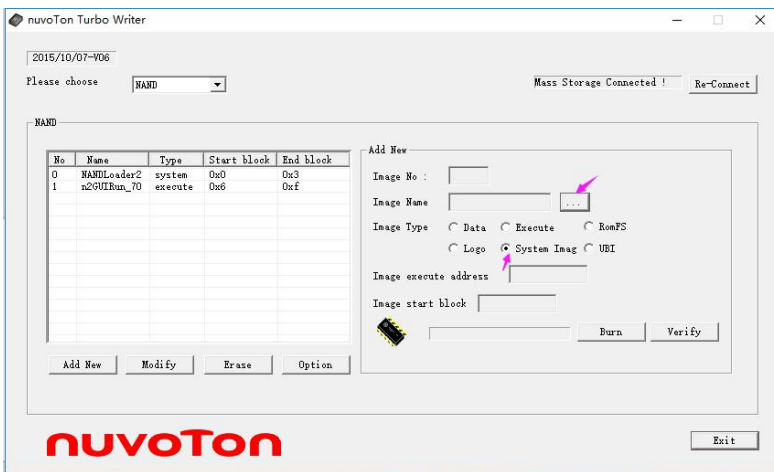


8. Run “N329\_HMI\_181216”-”926”

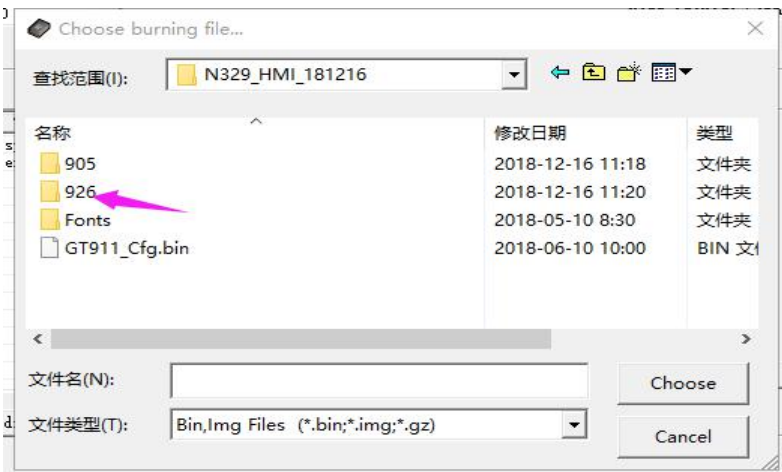


9. Select “NANDLoader2”

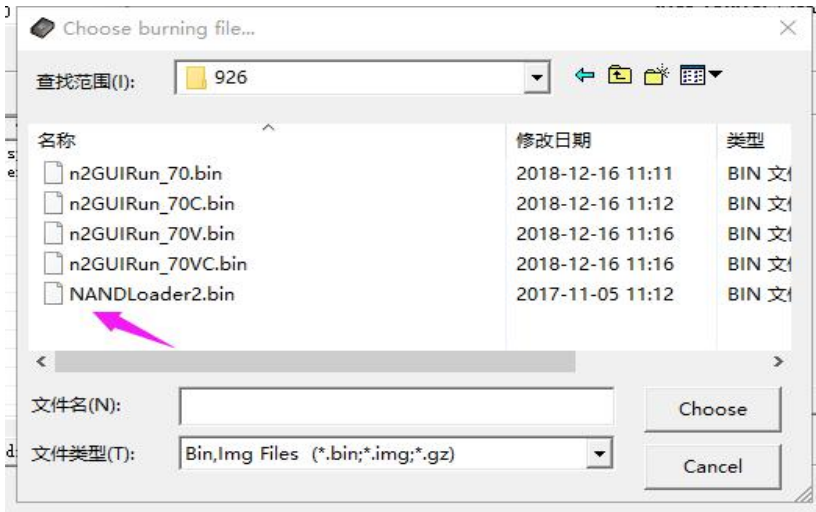


10. First click “Burn”, and then “yes”

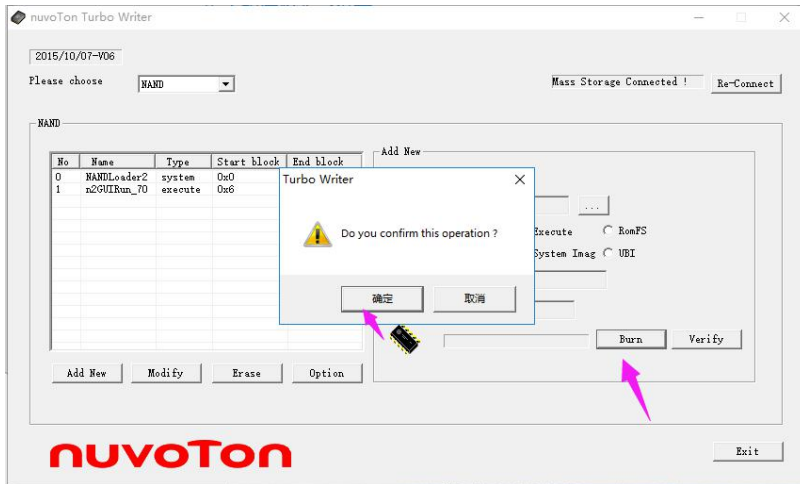


11. After loading , confirm it

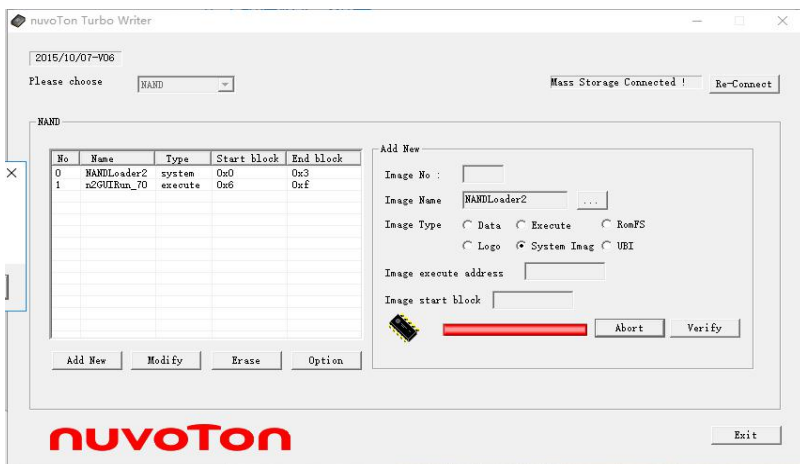


12. Choose "Execute", Set parameter as below:

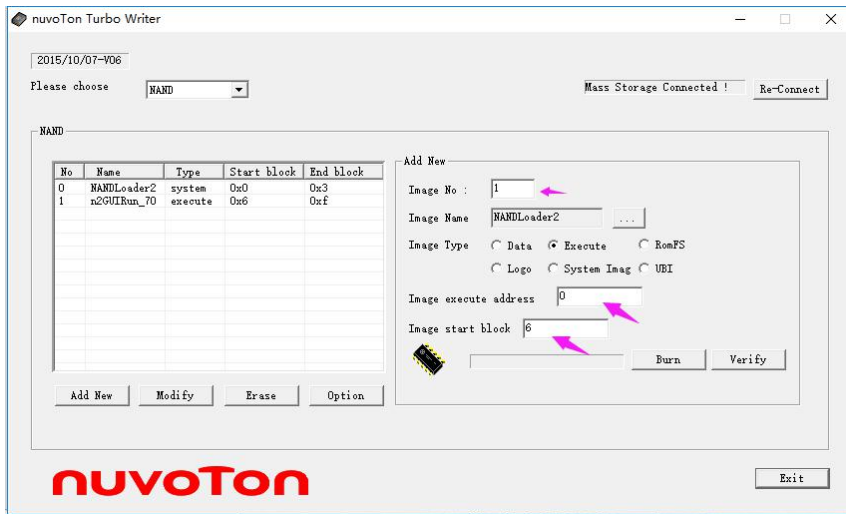


13. Click "....." to select file

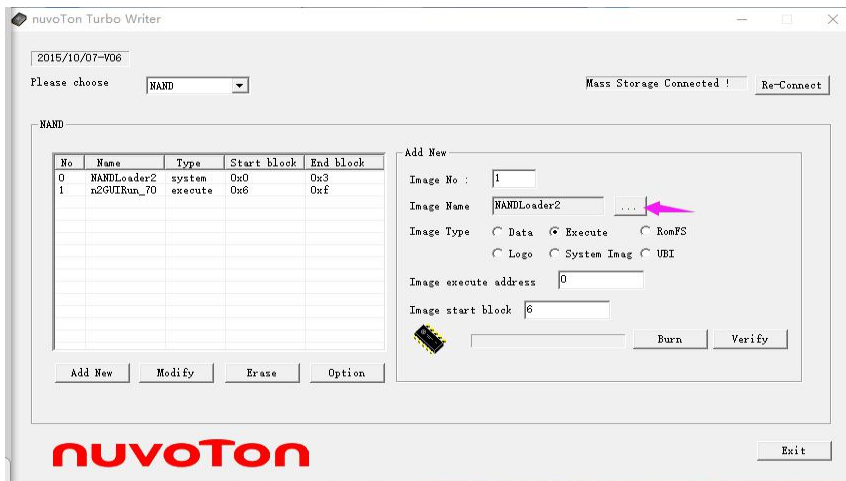

14. Choose "n2GUIRun\_70.bin" file

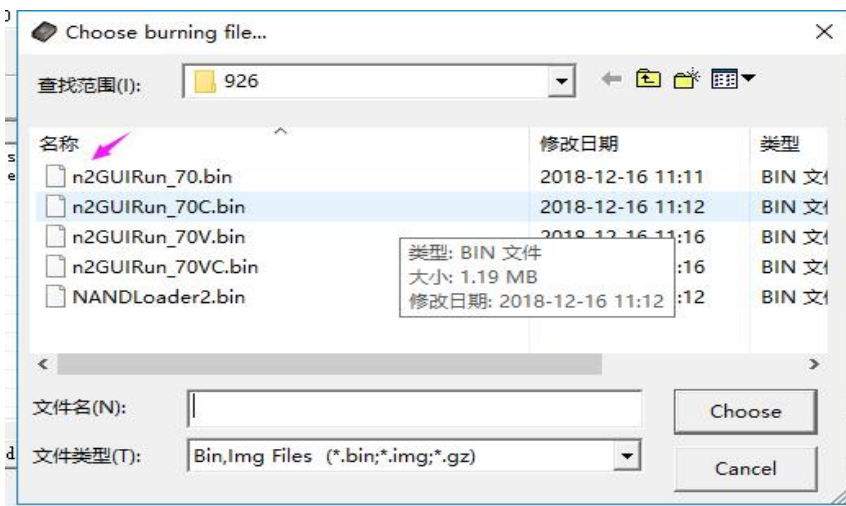


15. Click “Burn” and confirm it.

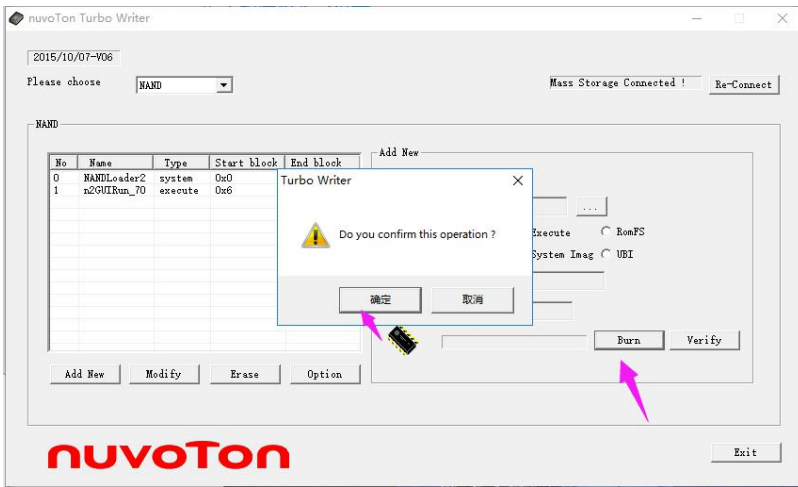

16. After updating, power off products, and switch the no1 back to its original as below:



17. Re-power on products, enter the HMI display, and change hardware no from 2 to be 1,confirm and then click “return”.

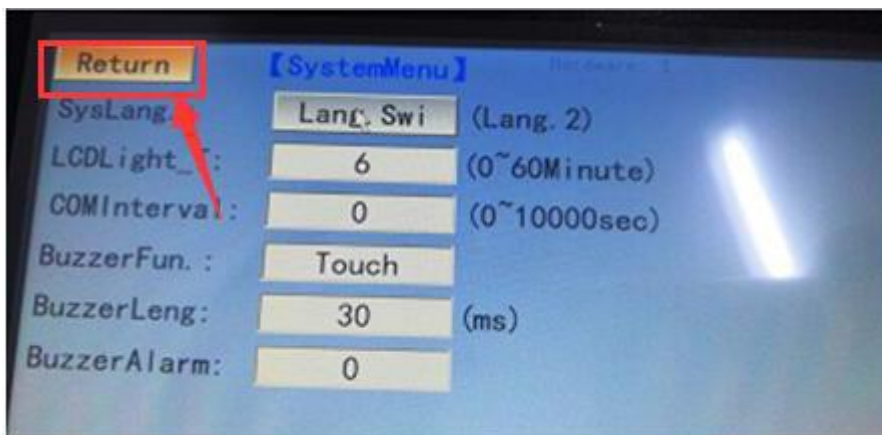

18. Later, power off products and wait about 1 min , and then power on to check whether it remains 1.

